

RM/RMD SPARE PARTS LISTING

General Notes:

Always replace parts using LRC Coil parts for maximum life from the unit.


DISCONNECT POWER BEFORE SERVICING UNIT OR INJURY MAY RESULT

Interpreting Serial Numbers

LRC Coil serial numbers are arranged with a unique serial number and date code.

#####-YYMM

- unique serial number
YYMM – Year Month of manufacture

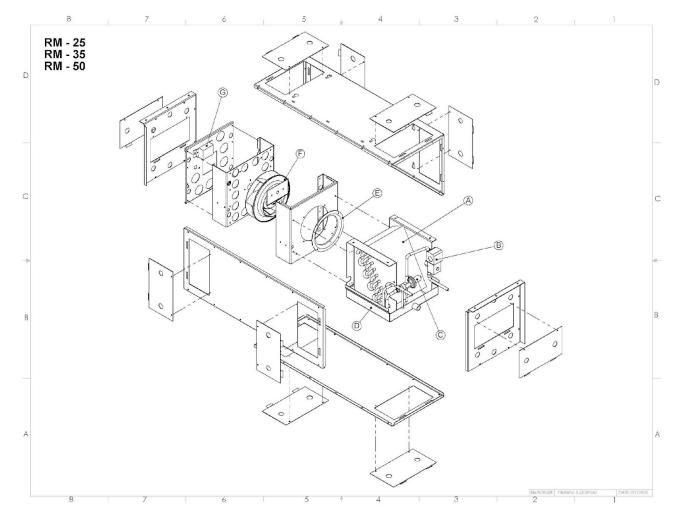

Note: Pre 2014 a 2 port (internally equalized) AXV was used. After that a 3 port (externally equalized) AXV was used. Always verify which configuration the customer wants. It is recommended that a 3 port/externally equalized valve be used for maximum system reliability.

Model	Part Description	PN	Comment
RM-25	A-Coil Assy-includes coil, coating, AXV, LLSV	26619-30 (EC & Reg.)	Coil assy is coated, w/ AXV, LLSV, Not coated pre-2009
	B-LLSV-Sol+Valve (120vac coil)	2351 + 2760	Recommended to replace both
	B(optional) -LLSV-Sol+Valve (24vac coil)	2351+3130	Recommended to replace both
	C-AXV	2 Port - 2847	Pre late 2014 – verify config.
		3 Port - 3628	Recommended
	D-Drain Pan	19895-01 (EC & Reg.)	Stainless Steel
	E-Inlet Ring	Part of Impeller Kit	Replace as part of set
	F-Impeller	2274-kit (120V, PSC) 3414-kit (230V, PSC) 4331 (120V, ECM)	Impeller, ring and capacitor EC motor w/ adapter plate for 4074EC
	G-Speed Ctrl	2953 (120V) 3653 (230V)	2.5 Amp (do not use on EC models)
		4248	Potentiometer (EC Models only)
RM-35	A-Coil Assy-includes coil, coating, AXV, LLSV	26620-20 (EC & Reg.)	Coil assy is coated, w/ AXV, LLSV, Not coated pre-2009
	B-LLSV-Sol+Valve (120vac coil)	2351 + 2760	Recommended to replace both
	B(optional) -LLSV-Sol+Valve (24vac coil)	2351+3130	Recommended to replace both
	C-AXV	2 Port - 2847	Pre late 2014 – verify config.
		3 Port - 3628	Recommended
	D-Drain Pan	20551-00 (EC & Reg.)	Stainless Steel
	E-Inlet Ring	Part of Impeller Kit	Replace as part of set
	F-Impeller	2274-kit (120V, PSC) 3414-kit (230V, PSC)	Impeller, ring and capacitor

	4331 (120V, ECM)	EC motor w/ adapter plate for 4074EC
G-Speed Ctrl	2953 (120V) 3653 (230V)	2.5 Amp (do not use on EC models)
	4248	Potentiometer (EC models only)

Model	Part Description	PN	Comment
RM-50	A-Coil Assy-includes coil, coating, AXV, LLSV	26622-20 (EC & Reg.)	Coil assy is coated, w/ AXV, LLSV, Not coated pre-2009
	B-LLSV-Sol+Valve (120vac coil)	2351 + 2760	Recommended to replace both
	B(optional) -LLSV-Sol+Valve (24vac coil)	2351+3130	Recommended to replace both
	C-AXV	3 Port - 3628	AXV
	D-Drain Pan	20551-00 (EC & Reg.)	Aluminum w/ coating
	E-Inlet Ring	Part of Impeller Kit	Replace as part of set
	F-Impeller	2274-kit (120V, PSC) 3414-kit (230V, PSC)	Impeller, ring and capacitor
		4331 (120V, ECM)	EC motor w/ adapter plate for 4074EC
	G-Speed Ctrl	2274-kit (120V, PSC) 3414-kit (230V, PSC)	Impeller, ring and capacitor
		4331 (120V, ECM)	EC motor w/ adapter plate for 4074EC

LRC Coil Company Rev 230209 Page 4 of 5

RM-65	A-Coil Assy-includes coil, coating, AXV, LLSV	26677-10 (EC & Reg.)	Coil assy is coated, w/ AXV, LLSV, Not coated pre-2009
	B-LLSV-Sol+Valve (120vac coil)	2351 + 2760	Recommended to replace both
	B(optional) -LLSV-Sol+Valve (24vac coil)	2351+3130	Recommended to replace both
	C-AXV	2 Port - 2847	Pre late 2014 – verify config.
		3 Port - 3628	Recommended
	D-Drain Pan	20551-00 (EC & Reg.)	Stainless Steel
	E-Inlet Ring	Part of Impeller Kit	Replace as part of set
	F-Impeller	2274-kit (120V, PSC) 3414-kit (230V, PSC)	Impeller, ring and capacitor
		4331 (120V, ECM)	EC motor w/ adapter plate for 4074EC
	G-Speed Ctrl	2274-kit (120V, PSC) 3414-kit (230V, PSC)	Impeller, ring and capacitor
		4331 (120V, ECM)	EC motor w/ adapter plate for 4074EC