

SL, SLE, SLA SERIES UNITS SPARE PARTS LISTING

General Notes:

Always replace parts using LRC Coil parts for maximum life from the unit.


DISCONNECT POWER BEFORE SERVICING UNIT OR INJURY MAY RESULT

Interpreting Serial Numbers

LRC Coil serial numbers are arranged with a unique serial number and date code.

#####-YYMM

- unique serial number
YYMM – Year Month of manufacture

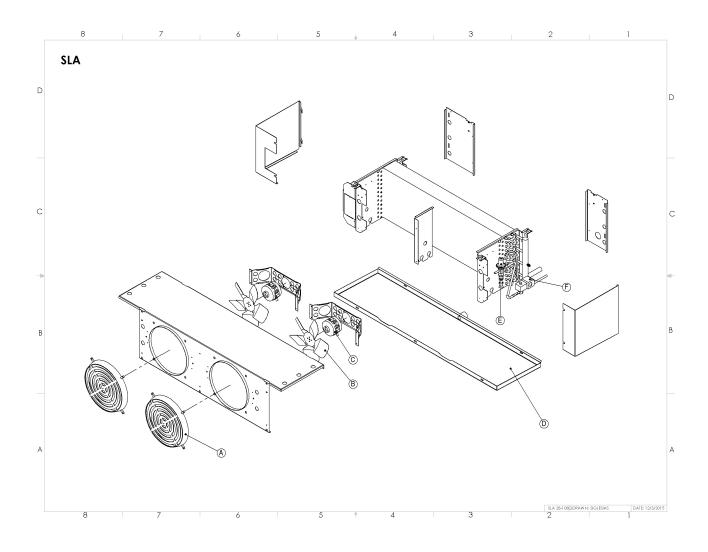

Model	Part Description	PN	Comment
A	Fan Guard - Plastic	3088	
	Fan Guard – White Wire	1037	No longer available
В	Fan Blade		
	Q (Wine) Series Models -	2295 3100 – Rev Airflow	
	Regular - Refrigeration	2295	
С	Motor		
	120VAC – EC Motor	3707	Must specify Q or Regular model
	230VAC – EC Motor	3708	Must specify Q or Regular model
D	Drain Pan		
	SL Series (Pre 2001) – 1 Fan	A-2593-1	SL-420, SL-510, SLE-355
	2 Fan	A-2593-2	SL-700, SL-840, SL-1020, SLE-580, SLE-710
	3 Fan	A-2593-3	SL-1530, SLE-1065
	4 Fan	A-2593-4	SL-1690, SL-2040, SLE-1420
	5 Fan	A-2593-5	SL-2550, SLE-1775
	6 Fan	A-2593-6	SL-3060, SLE-2130
	SLA Series (Current) – 1 Fan	14987-00	SLA & SLE
	2 Fan	14988-00	SLA & SLE
	3 Fan	14955-00	SLA & SLE
	4 Fan	14989-00	SLA & SLE
	5 Fan	14990-00	SLA & SLE
	6 Fan	14991-00	SLA & SLE
Е	AXV (Quiet Units Only)	3628	AXV externally equalized.
	Regular TXV's – Consul	t Refrigeration Wholesaler	
F	LLSV		
	Coil - 24VAC	3130	Alco
	Coil - 120VAC	2760	Alco

	Coil - 240VAC	2761	Alco
	Valve	2351	Alco
G	Defrost Heaters – Pre 2	001	
	1 Fan	1220	1 per unit located in Pan, 20", 1100W, 230VAC
	2 Fan	1221	1 per unit located in Pan, 1900W, 37", 230VAC
	3 Fan	1216	1 per unit located in Pan, 2600W, 54", 230VAC
	4 Fan	1217	1 per unit located in Pan, 3500W, 71", 230VAC
	5 Fan	1219	1 per unit located in Pan, 4100W, 88", 230VAC
	6 Fan	1218	1 per unit located in Pan, 4100W, 105", 230VAC
	Defrost Heaters – Post 2	2001	
	1 Fan	2219	2 per unit located in Pan, Center of Coil, 22", 550W, 230VAC
	2 Fan	2220	2 per unit located in Pan, Center of Coil, 39", 950W, 230VAC
	3 Fan	2251	2 per unit located in Pan, Center of Coil, 1025W, 56", 230VAC
	4 Fan	2222	2 per unit located in Pan, Center of Coil, 1750W, 73", 230VAC
	5 Fan	2223	2 per unit located in Pan, Center of Coil, 2050W, 90", 230VAC
	6 Fan	2050	2 per unit located in Pan, Center of Coil, 2050W, 107", 230VAC
Н	Defrost Control		
	Pre 2001	Obsolete	Ranco F25 series controller-available at wholesalers
	Post 2001	2306 – Fan Delay	Brown/Red wires, open @45, Close @35
		2305 – Defrost Termination	Black/Red wires, Open @ 30, Close @ 50 +/-5
		2166 – Heater Safety	Heater Safety Switch, 14T21 30313

Units built before 1990 used a motor mounted external through the fan guard. These fan guard/motor mounts are no longer available.